






# APPLICATION SPECIFICATION




LANGUAGE

ENGLISH

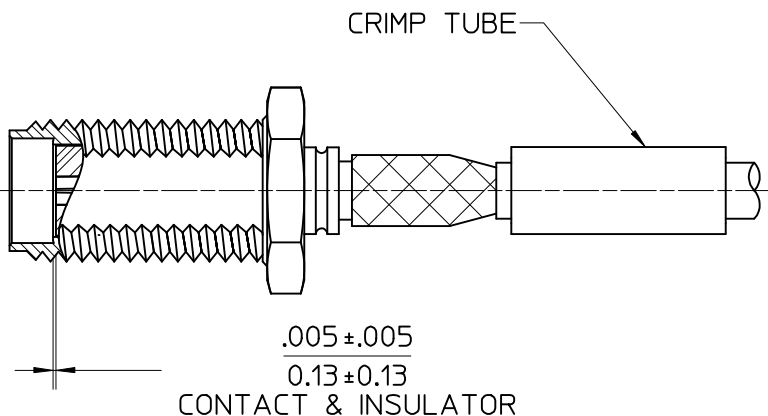


3. FLARE BRAID AND INSERT CABLE INTO CONNECTOR TO DIMENSION SHOWN.

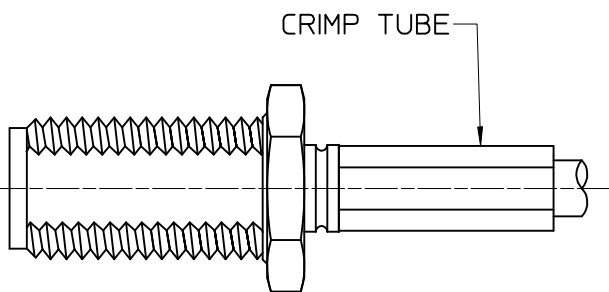

4. SLIP CRIMP TUBE OVER BRAID UNTIL BOTTOMS ON CONNECTOR BODY.

CRIMP USING .128 HEX. DIE

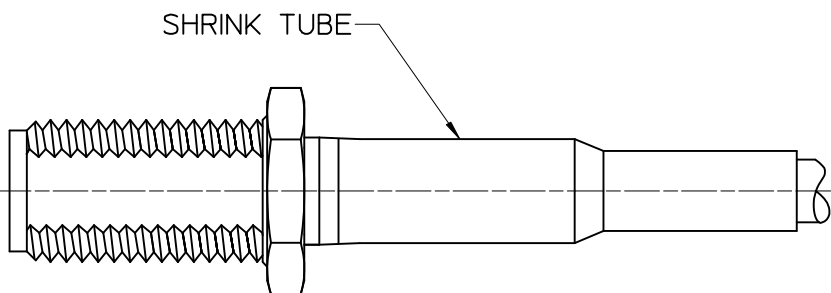

5. SLIP SHRINK TUBE OVER CONNECTOR UNTIL IT BOTTOMS BEHIND THE FLANGE AS SHOWN. APPLY HEAT.

REVISE ON PC ONLY

3

Assembly Instructions  
89675-1640 per  
ECN URF-xxxx

TITLE

CABLE ASSEMBLY INSTRUCTIONS FOR SMA JACK  
CA-SMA

THIS DOCUMENT CONTAINS INFORMATION THAT IS PROPRIETARY TO  
MOLEX INC. AND SHOULD NOT BE USED WITHOUT WRITTEN PERMISSION

REV DESCRIPTION

DESIGN CONTROL  
URF

STATUS

WRITTEN BY:  
TEF

CHECKED BY:  
SSS

APPROVED BY:  
GMH

DATE: YR/MO/DAY  
12/20/01

DOCUMENT NO.

ES-89675-164

FILE NAME:  
ES-89675-164

SHT NO.  
2 of 2